


SAFETY ALERT

**OTHER
YARD**

SUMMARY:

The worker was carrying out grinding work while wearing an air suit. He finished working on the 4th level and went down to the 3rd level to work in cargo tank. He incorrectly connected the air hose to the argon manifold which caused suffocation. He was found by his co-workers and transported to hospital where CPR attempts to revive him failed.

Cause of the accident was the incorrect fitting of air manifold to the argon connectors and incorrect fitting of argon manifold to the air connectors. The color coding and signage were correct on both the argon and air manifolds – only the connectors were incorrect.

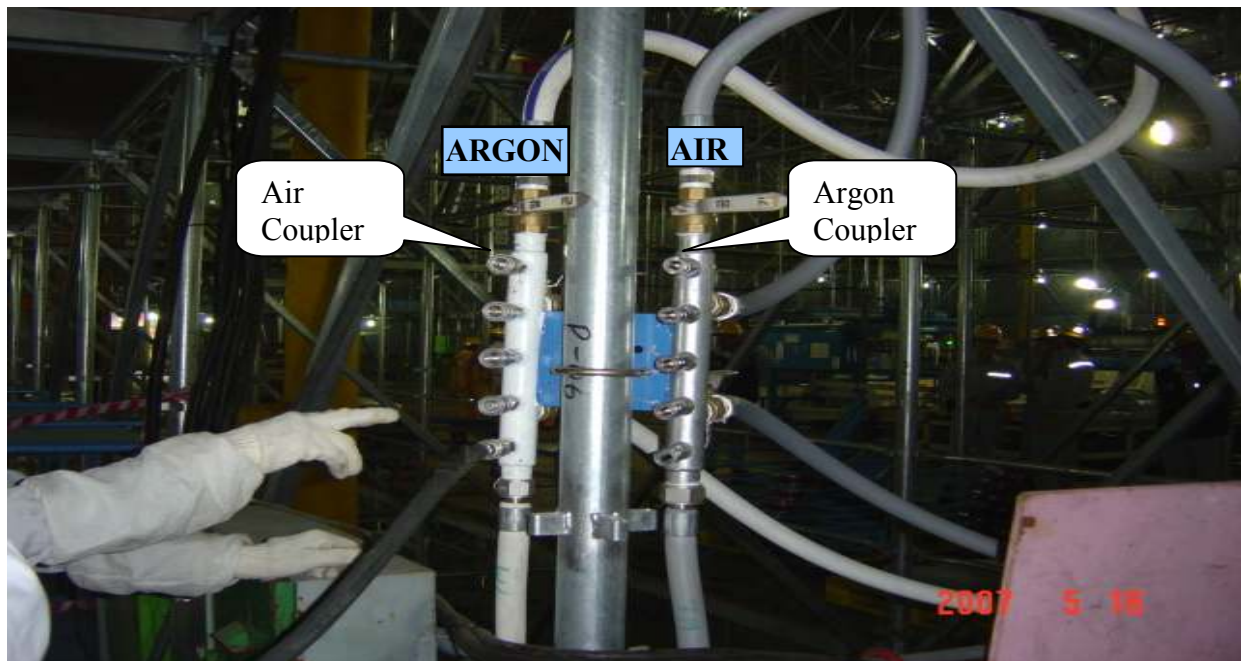

TIME & DATE:

3:55 p.m. 16th May 2007

LOCATION:

"D" Company in Geoje

PERSONAL DAMAGE

Fatality due to suffocation

ACTION TAKEN BY SHI:

Safety alert distributed to all departments to educate workers during TBM.
Inspected the condition of all manifolds in the yard.